

TECHNICAL BULLETIN

PRODUCT: BOSCH CE 19 NA and CE 12 NA CHP

FLUE ARRANGEMENTS AND CONDENSATE DRAINAGE

Bosch issued a revised schematic drawing for the flue arrangement during the release of the CE 19 NA2 back in May 2014. The schematic (attached) sets out a typical arrangement for the flue, incorporating the primary and secondary silencers. The drawing also sets out the specification for the type of high pressure, fully sealed flue system that is required.

For the flue to operate correctly, it is fundamental that any condensate which forms within the flue is drained away without causing restrictions. Most important for this function is the condensate drain which is shown at the base of the main flue stack (Fig. 1). This condensate drain removes the bulk of the condensate and should be treated as the primary drain point.

Therefore this drain point is mandatory on all CHP flue systems.

If this drain point is not in place, it is possible for large quantities of condensate to become trapped in the lower section of the flue, where there is greatest velocity of the flue gasses. Protection systems within the CHP, which guard against flue blockages, can operate, leading to nuisance lockouts.

A trap, which is fitted to the base of the flue system, must have a minimum 350mm water seal and be made from a suitable material for a flue system. The trap must be positioned immediately below the spigot rather than in line, in accordance with BS 6644-2011 6.10.4 fig 3 (example shown in Fig. 2 opposite). The pipe work must be taken straight to drain and be open to atmosphere.

Any horizontal section of flue system must have a minimum 3° fall in the direction of the flow of flue gases, towards the condensate trap, to ensure condensate drains away effectively. This is easily achieved with a tee arrangement at the base of the flue stack, incorporating a drain point.

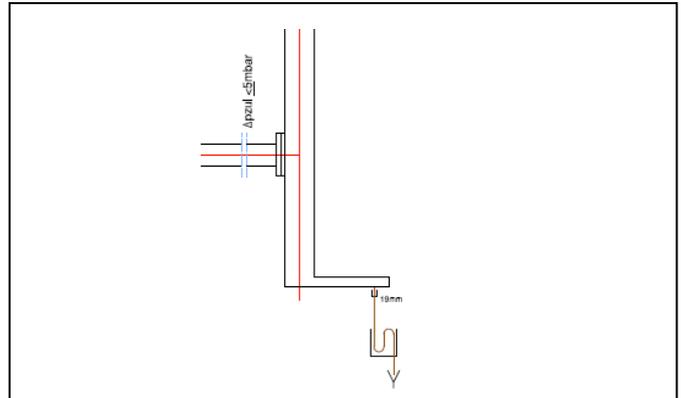


Fig. 1: Primary condensate drain and trap located at the base of the flue system

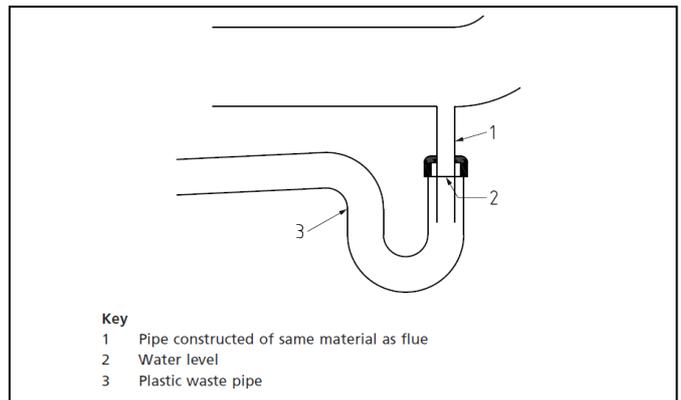


Fig.2: Detail of trap arrangement showing the trap connected immediately below the spigot from the flue system drain.


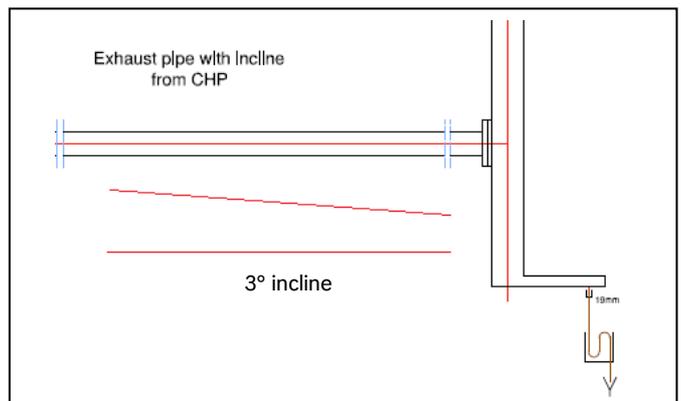


Fig.3: 3° incline towards the primary condensate drain point



TECHNICAL BULLETIN

PRODUCT: BOSCH CE 19 NA and CE 12 NA CHP

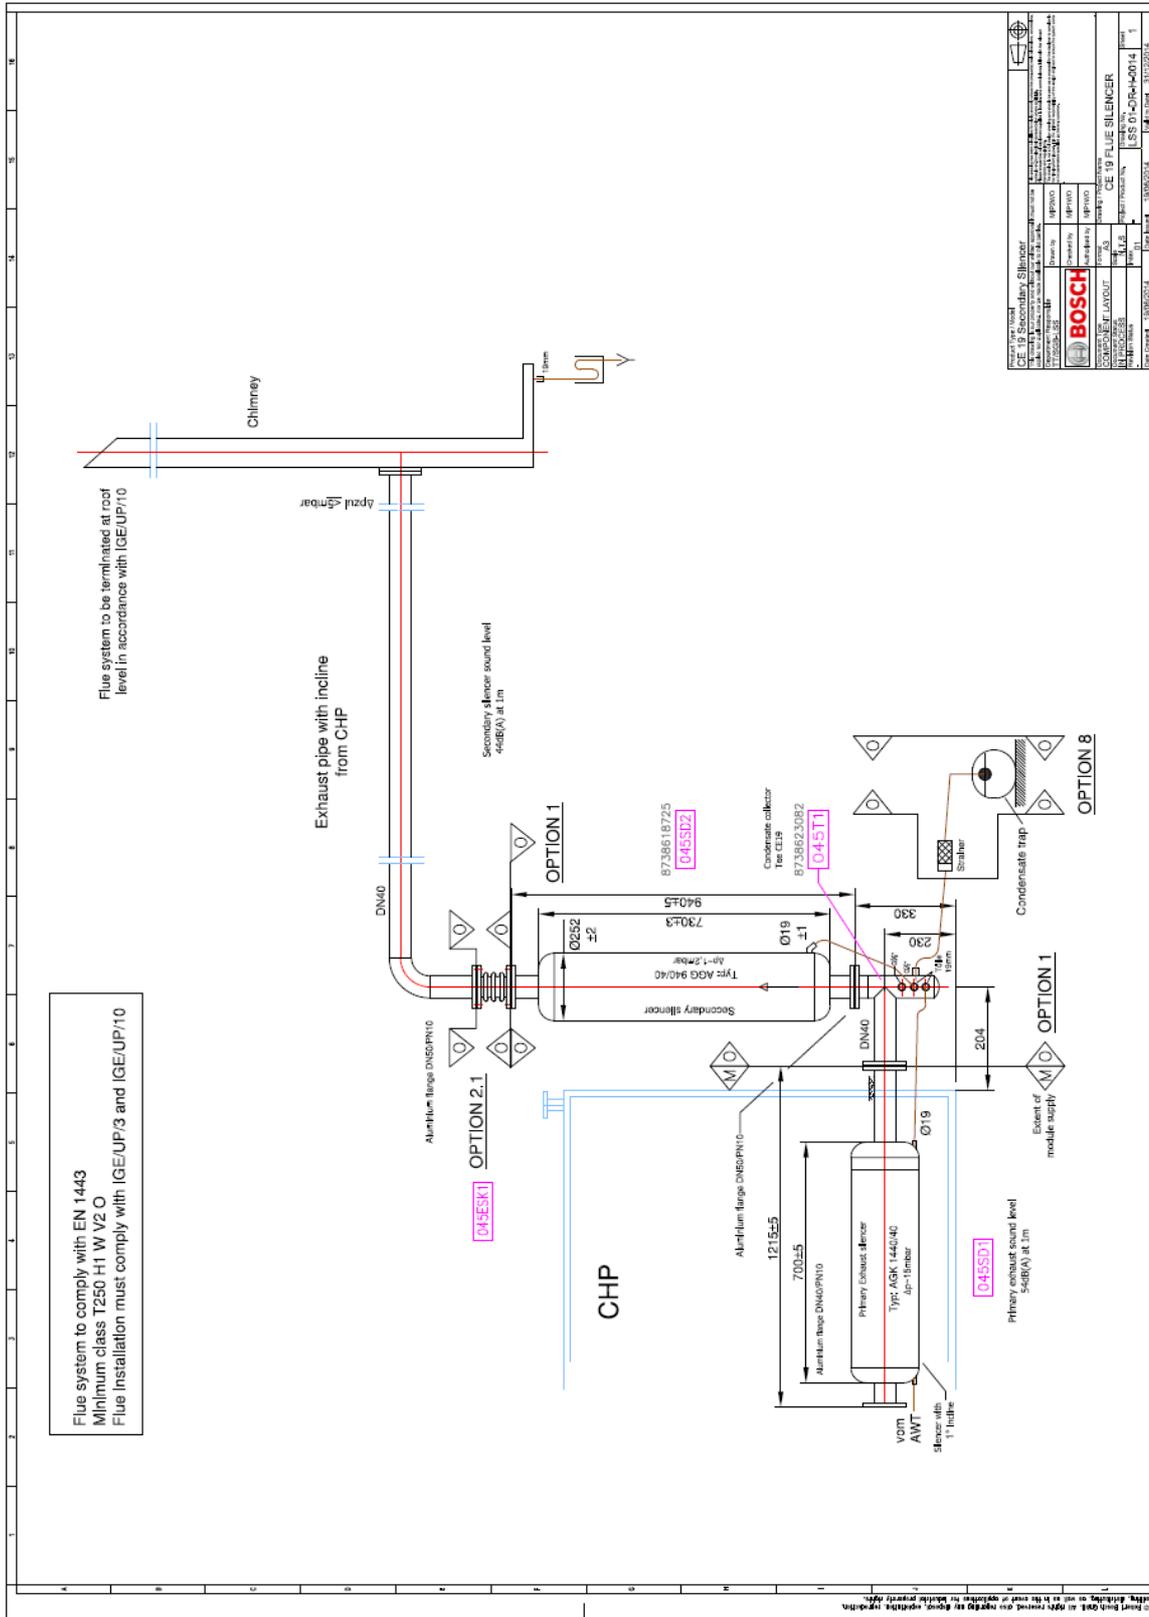

Whilst it is always our intention to fully assist, it is essential to recognise that all information given by the company in response to an enquiry of any nature is provided in good faith and based upon the information provided with the enquiry. We recommend that advice should always be checked with your installer or contract partner. Consequently, the company cannot be held responsible for any liability relating to the use or repetition of such information or part thereof. In addition, whilst making every reasonable effort to monitor the performance and quality of our supply, installation and service network, we do not accept responsibility for the workmanship or operation of any third party company that the company may have promoted either in conversation, e-mail or other communication.

Similarly, the views and opinions expressed in communication with individuals within the company may not reflect that of the business as a whole.



BOSCH

Bosch Thermotechnology Ltd, Cotswold Way, Warndon, Worcester WR4 9SW
 Technical Services Tel: 0330 123 3004, Fax: 01905 753130, email: Technical-Advice@uk.bosch.com

You can find this, and all issued technical bulletins on the Buderus web site at: <http://www.bosch-industrial.co.uk/tb>